




KURARAY POVAL™ for Textile Sizing

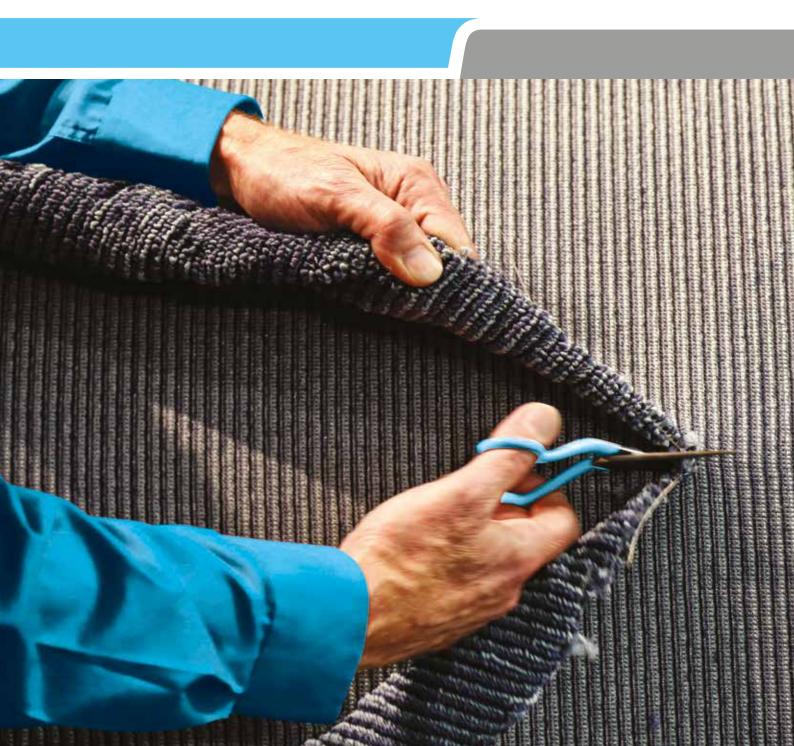

The textile manufacture of spun yarn, which has grown based upon cotton, has a long history, and starch was used as a warp size from its beginning. As the use of polyester and polyester cotton yarn has increased, so have the demands on textile size. The need for productivity and quality has justified the higher cost of PVOH compared to starch. As weavers get used to the advantages of PVOH, it has become common to use PVOH on cotton yarns, with or without starch in the size.

KURARAY POVAL[™] is manufactured with careful control of degree of polymerization and degree of hydrolysis. KURARAY POVAL[™] solution forms a film very easily. Films of PVOH are superior to other resins in tensile strength, tear strength and abrasion resistance.

KURARAY POVAL[™] absorbs moisture less than other water-soluble resins, such as acrylic resin, starch, etc. KURARAY POVAL[™] requires less humidity in the weave room. Besides, KURARAY POVAL[™] has excellent adhesion, especially to synthetic fibre.

Overall, KURARAY POVAL[™] is consistently in high quality giving excellent efficiency in weaving over wide range of fabrics and looms.

CONTENTS

ADVANTAGES OF KURARAY POVAL[™] ------ 1

KURARAY POVAL[™] GRADES FOR TEXTILE ----- 1

- PVOH Production Process
- Factors Dominating PVOH Properties
 - Degrees of Polymerization Degrees of Hydrolysis

GRADES of KURARAY POVAL[™] ----- 2

GUIDELINES TO USE KURARAY POVAL™------ 3

- Abrasion Resistance
- Residual Strength of Sized Yarn after Abrasion by Stationary Weaving

GUIDELINES for FABRIC FORMULATION KURARAY POVAL™ -----

KEY POINTS OF SIZED YARN AND SIZE FOR AIR JET LOOM ----- 4

SLASHING -----5

• Operating Conditions in Slashing will Affect Weaving Performance

PREPARATION OF KURARAY POVAL[™] ------5

ADVANTAGES OF KURARAY POVAL™

Good Adhesion; excellent strength and abrasive resistance of the formed coating -> Excellent protective action to the yarns, and minimium warp breakage during weaving -> Higher weaving efficiency and better quality of the fabrics. Decreasing rate of warp breakage is 20% ~ 50%.

Effective in sizing performance with low size add-on.

No size drop during sizing or weaving -> Better working environments and less cleaning work.

Weaving under relatively low humidity -> Better working environments and greater work efficiency. The best humidity in weaving room is 70 ~ 75% R.H.

Uniform properties and effectiveness of a size -> Stable weaving efficiency.


KURARAY POVAL™ **GRADES FOR TEXTILE**

PVOH Production Process

Vinyl acetate monomer POLYMERIZATION Polyvinyl acetate HYDROLYSIS

Polyvinyl alcohol

(PVOH)

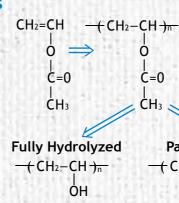


Factors Dominating PVOH Properties

(1) Degree of Polymerization	
Typical degrees of polyme	rization (n)
500~600	Low Viscosity
1700~2400	High Viscosity

(2) Degrees of Hydrolysis Showed by mole%: x100 Typical degrees of hydrolysis 98~99 mole % ------ Fully Hydrolyzed 87~89 mole % ------ Partially Hydrolyzed




(compare to starch)

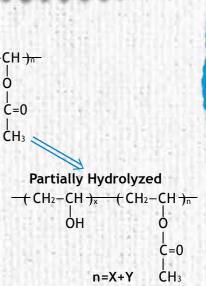

GRADES OF KURARAY POVAL™

1.	Grade		Specifications				
	[KURARA)	POVAL™]	Viscosity [mPa.s]	Hydorolysis	Volatile Max	Ash Max	ax pH
	Standard Type	Anti-foaming/ Defoaming type		[mol%]	[%]	[%]	
	5-88	5-88 MB	4.6 - 5.4	86.5 - 90.0	5.0	0.4	5.0-7.0
Partially	22-88	22-88 SB 22-88 PK	20.5 - 24.5	87.0 - 89.0	5.0	0.4	5.0-7.0
Hydrolyzed	30-88	30-88 SB 30-88 DB	27.0 - 33.0	87.0 - 89.0	5.0	0.4	5.0-7.0
	44-88	44-88 SB	40.0 - 48.0	87.0 - 89.0	5.0	0.4	5.0-7.0
Medium	27-96	나라 안 하지 않는	24.0 - 30.0	95.5 - 96.5	5.0	0.4	5.0-7.0
Hydrolyzed	17-94	1 - 1 / St.	14.5 - 18.5	92.5 - 94.5	5.0	0.4	5.0-7.0
	5-98 5.2	5.2 - 6.0	98.0 - 99.0	5.0	0.6	5.0-7.0	
Fully Hydrolyzed	28-98	28-98 DB	25.0 - 31.0	98.0 - 99.0	5.0	0.4	5.0-7.0

Figure 1: Dissolving Rate of KURARAY POVAL™

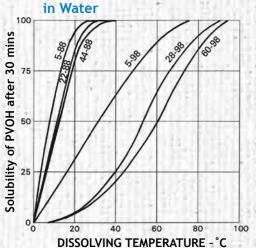

Percent of dissolved PVOH after 30 minutes under agitation at 2,000rpm. when 4 parts of PVOH are added to 96 parts of water

Table 1: Percentage of Affinity of KURARAY POVAL[™] with Various Kinds of Fibers

Percentage of Affinity				
Grade of PVOH Fibers	28-98	22-88	5-98	5-88
Cotton*	100	92	95	115
Viscose rayon	100	95	95	93
Bamberg	100	120	97	110
Acetate	100	300	120	250
Vinylon	100	105	100	115
Nylon	100	210	90	190
Polyester	100	195	110	250

1) The affinity of other grades of KURARAY POVAL Note: compared with that of 28-98 (=100) 2) * Bleached cotton is used.


GUIDELINES TO USE KURARAY POVAL™

PVOH is commonly used for warp sizing in combination with starch. Through a lot of experiences in the field, it has been proved that the following two basic methods, which draw best performance of PVOH and starch are the nost suitable for warp sizing.

"PVOH rich method" and "Starch rich method"

- PVOH:Starch ----- PVOH method 7:3
- Starch:PVOH ------ Starch rich method 7~8:3~2

Below described figures graphically illustrate the characteristics of a combination KURARAY POVAL™ and starch according to certain blending ratios.

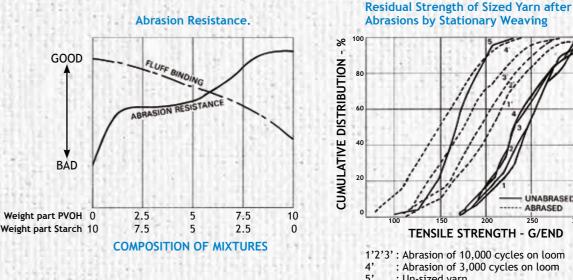



5'

Guides for Fabric Formulation with KURARAY POVAL™

Size Formula	Shuttle	Rapier	Projectile	Air Jet
% PVOH	80	80-100	80-100	65-100
% Starch	20	20-0	20-0	35-0
% CMC	112231	1211		n thit i
% Wax	7-10	7-10	7-10	7-10
% Urea	0-6	6-0	6-0	6-0
% Acrylic	125/11/1	0-6	0-6	0-6
% Polyester			1	111.14
% Other				1.66
% Add-On	11-12	14-11	14-11	13-10

Figure 2: Viscosity Concentration Relationship for Aqueous Solutions of KURARAY POVAL[™] at Various Temperature

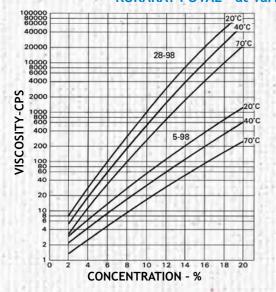


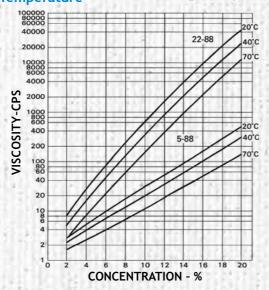

Starch and CMC.





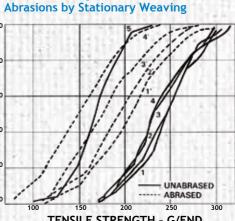

TENSILE STRENGTH - G/END

1'2'3': Abrasion of 10,000 cycles on loom : Abrasion of 3,000 cycles on loom : Un-sized varn

- Size Composition: 1 1' 28-98 only Size take up 5.4%
- 2 2' 28-98: Corn Starch=7:3. Size take up 8.1%
- 3 3' 28-98: Corn Starch=1:5 Size take up 11%
- 4 4' Corn Starch only. Size take up 15%

Fiber: 100% Cotton Weave: Denim Yarn: 10/1 to 20/1

	<i>,</i> ,,,		1 1 1 1 A	
Size Formula	Shuttle	Rapier	Projectile	Air Jet
% PVOH		0-15	80-100	11810
% Starch	101.00	100-85	20-0	
% CMC		11.51 (13		
% Wax	diam'r.	7	7	
% Urea		1111	1111023	
% Acrylic		15-0	15-0	1 M N
% Polyester	all.	1.18124		
% Other	ana n	2.26		1633
% Add-On		13-11	13-11	

Note: %Wax and additives based on total of PVOH, Starch and CMC.

3

KEY POINTS OF SIZED YARN AND SIZE FOR AIR JET LOOM

10018-618	Sized yarn	Sizing material	
Spun yarn	•Good shedding	•Good fluff-binding • Smoothness	 Proper size take-up (15% more than conventional looms) Proper viscosity of size solution Good splittability Smoothness of size film
	•High abrasion resistance	• High abrasion resistance to stand up to high speed motion (reed, heald, dropper etc.)	• Film properties of size (strength, elongation, pliability, moisture absorbency, smoothness)
Filament	•Good shedding	 Cohesive performance of fibers Good elongation, pliability, smoothness to stand up to high speed 	 Adhesiveness Permiability Smoothness Pliability Anti-static property Non-stickiness
	•High abrasion resistance	• High abrasion resistance to stand up to high speed motion (reed, heald, dropper etc.)	 Adhesiveness Pliability Smoothness Film strength & elongation
Common with spun & fil.	• Uniform quality	 The quality of raw yarn Uniform size-take-up 	 The stability of size solution viscosity Good compatibility of sizing materials
	• Go	Good desizability	



SLASHING

The primary purpose of sizing is to increasing weaving efficiency via reducing warp stops by the application of a protective coating on the warp yarn. On the other hand, the primary function of sizes is to improve abrasion resistance to warp yarns. The effectiveness of sizes varies with mass of add-ons and types of materials such as PVOH, starch, etc. Abrasion testing of sized yarns provides a means of comparing the effectiveness of sizes and thus their relative costs, for example, X pounds of Size A = Y pounds of Size B. Of course, abrasion resistance is not the only determinant of weaving efficiency.


Operating Conditions in Slashing Will Affect Weaving Performance

Besides the size formulation, consistency and quality of the loom beams make a big difference in the weave room. Some items to check for include:

- 1) Consistency of size add-on from side to side and loom beam to beam.
- 2) Yarn sticking to the dryer(s)
- 3) Yarns out of lease
- 4) Size distribution size mainly on the outside of the yarns to improve abrasion resistance and penetration of size into the yarns to help strengthening them.
- 5) Too much size (shedding, difficult tight weaves)
- 6) Too little size (abrasion breaks, weak yarn)

The list could be much longer, but the operation of the slasher should be controlled as any modern industrial process.

PREPARATION OF KURARAY POVAL™

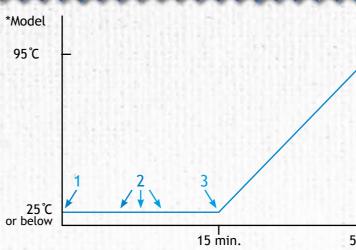

(1) Start stirring. Stirring must be kept for all the dissolving process. (2) Charge KURARAY POVAL[™] gradually.

(3) Start heating up. Raise the temperature 2°C per minute as standard. (4) After getting 95 $^{\circ}$ C, continue stirring for 60 minutes, as standard, to get complete solution.

NOTE: Partially hydrolyzed grades of PVOH tend to form lumps at the time of charging into water. In order to avoid this phenomenon and to achieve rapid and easy cooking, take care of the water temperature at charging time, the charging rate of PVOH and the stirring speed.



50 min. 110 min.

kuraray **poval** exceval elvanol

Adding value to your products - worldwide



KURARAY POVALTM, EXCEVALTM, ELVANOLTM and MOWIFLEXTM are the trademarks for polyvinyl alcohols made by Kuraray. Their key characteristics – outstanding film-forming properties and high binding strength – add real value to your products. Our polymers are water-soluble, highly reactive, crosslinkable and foamable. They have high pigment binding capacity, protective colloid characteristics and thickening effects. The physical and chemical properties of KURARAY POVALTM make it ideal for a wide variety of applications, ranging from adhesives through paper and ceramics to packaging films. Many of our polymers are food contactapproved and thus suitable for food applications. Ecologically KURARAY POVAL^M is advantageous due to its biodegradability and the fact that combustion does not generate residues. It is available in various particle sizes from granules to fine powders.

Kuraray produces its wide range of KURARAY POVAL[™] grades in Japan, Singapore, Germany and the USA. Kuraray's global production and service network make us your partner of choice for innovative high-quality PVOH resins.

KURARAY - Here to Innovate.

Kuraray America, Inc.

2625 Bay Area Blvd., Suite 600 Houston, TX77058 United States of America Phone: +1 800 423 9762 info.kuraray-poval@kuraray.com

Kuraray Europe GmbH

Philipp-Reis-Str. 4 65795 Hattersheim am Main, Germany Phone: +49 69 305 85 351 info.eu-poval@kuraray.com

Kuraray Asia Pacific Pte., Ltd.

250 North Bridge Road #10-01/02 Raffles City Tower Singapore 179101 Phone: +65 6337 4123 infopoval.sg@kuraray.com

Kuraray China Co., Ltd.

Unit 2207, 2 Grand Gateway 3 Hongqiao Road, Xuhui District, Shanghai 200030, China Phone: +86 21 6119 8111 infopoval.cn@kuraray.com

Head Office:

Kuraray Co., Ltd.

Ote Center Bldg. 1-1-13, Otemachi Chiyoda-ku Tokyo 100-8115, Japan Phone: +81 3 67 01 1000 infopoval.jp@kuraray.com

www.KURARAY-POVAL.com